
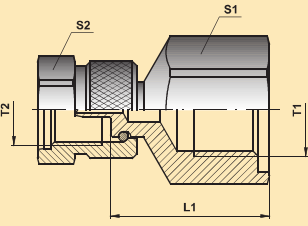


21 Diagnoseadapter SCA


Diagnoseadapter SCA

Diagnoseadapter  **SCA-1/4-EMA-3CF (Chromfrei)**




Bestell- bezeichnung	PN	Pmax	PBerst	T1	T2	L1	S1	S2
SCA-1/4-EMA-3	630 bar	1.200 bar	2.000 bar	1/4" BSPP	M16x2	32	27	22
SCA-1/2-EMA-3	630 bar	800 bar	1.200 bar	1/2" BSPP	M16x2	36	30	22
SCA-1/2-EMA-3-HP	630 bar	1.200 bar	2.000 bar	1/2" BSPP	M16x2	36	32	22

90°-Diagnoseadapter mit Messkupplung

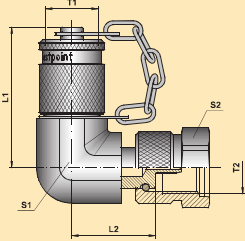


Bestell- bezeichnung	PN	Pmax	PBerst	T1	T2	L1	L2	S1	S2
SCA-90-EMA-3	630 bar	800 bar	1.200 bar	M16x2	M16x2	52	28,5	19	22


Diagnosekupplung

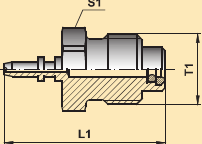


SCA-EMA-3/1

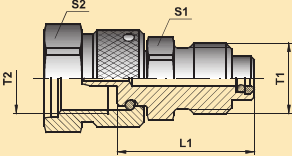

SCA-EMA-3/2

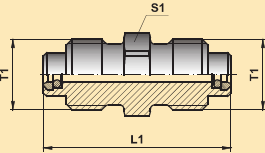

SCA-EMA-3/3

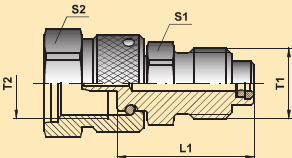

SCA-EMA-3/4

Bestell- bezeichnung	PN	Pmax	PBerst	T1	T2	L1	S1	S2
SCA-EMA-3/1	630 bar	800 bar	1.200 bar	M16x2	—	37	17	—
SCA-EMA-3/2	630 bar	800 bar	1.200 bar	M16x2	M12x1.65	31	17	22
SCA-EMA-3/3	630 bar	800 bar	1.200 bar	M16x2	M16x2	43	17	—
SCA-EMA-3/4	630 bar	800 bar	1.200 bar	M16x2	M16x1.5	31	17	22



Druckbereiche beachten!
Adapter dürfen nur zusammen mit den in diesem Katalog aufgeführten Produkten benutzt werden.